7. Atlee Dodge Aircraft Services, LLC.

P. O. Box 190409 ~ Anchorage, AK 99519 907-344-1755 or 877-33ATLEE

Fax: 907-344-6720

atleedodge@acsalaska.net ~ www.fadodge.com

# **SERVICE BULLETIN**

No. 3140 - LHA

Date: April 4, 2006 Revision: None

#### SUBJECT:

F. Atlee Dodge 30.5 Gallon LH Fuel Tank

## **MODELS AFFECTED:**

**All PA18 Series Aircraft** 

## **PURPOSE:**

A report from the field indicated the Forward Fuel Outlet Fitting located on the LH Tank was not being used.

This service bulletin is notifying the aircraft owner that the forward fuel outlet line must be connected in the same configuration of the stock Piper PA18 Fuel System.

#### **APPROVAL:**

### **INSTRUCTIONS:**

- 1. Remove the LH Lower Center Wing Root Panel, Piper Part Number 12274 00.
- 2. Inspect to ensure the Forward Fuel Outlet Feed is connected to the Forward Header Tank Vent Line, Part Number 11987- 23. Traceability of this line might require the removal of the Front LH Side Windshield Trim Strip, Part Number 12261- 00.
- 3. If the fuel system is found to be in the correct configuration, replace the Front LH Side Windshield Trim Strip and lower the LH Lower Center Wing Root Panel.
- 4. If the LH Forward Outlet Fitting, is not being used, refer to Piper PA18 Parts Manual for correct Fuel Line configuration.
- 5. Make a log book entry complying with this Service Bulletin.

## **EFFECTIVIVITY DATE:**

This service Bulletin is effective upon receipt.

#### **SUMMARY:**

Please contact F. Atlee Aircraft Services, LLC if you have any questions or written information regarding this Service Bulletin.

7. Atlee Dodge Aircraft Services, LLC

P. O. Box 190409 ~ Anchorage, AK 99519 907-344-1755 or 877-33ATLEE

atleedodge@acsalaska.net ~ www.fadodge.com

**Contact Person: Steve Kracke**